


Ultimate Adapter Installation Guide for Addi Circular Knitting Machine


Tools Needed:

- Small flat-head screwdriver
- Small phillips head screwdriver

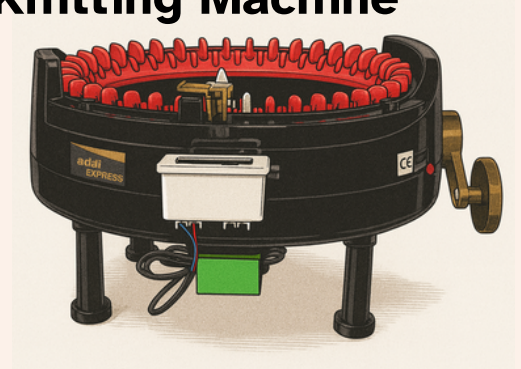


Step 1: Disassemble the Machine


Flip the knitting machine upside down.

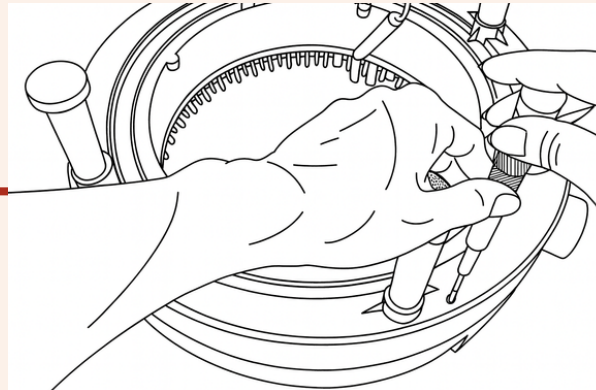

Using the small flat-head screwdriver, remove:

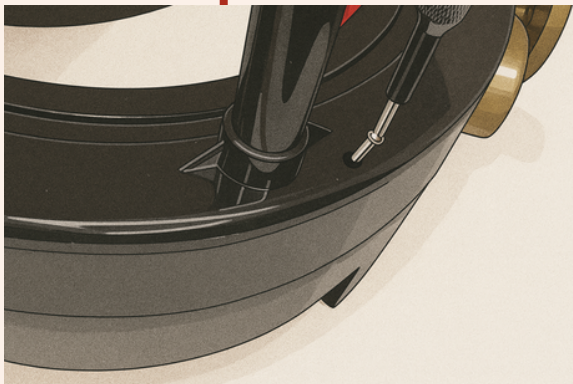


The **four screws** from the cover legs.

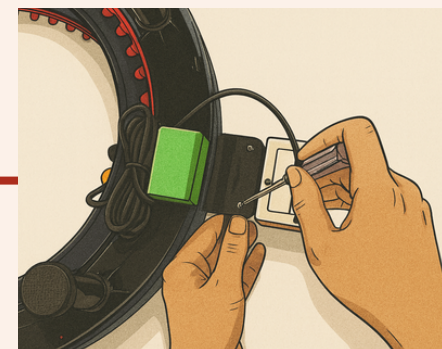


Using the small Phillips head screwdriver, remove, The two screws from the counter.


Keep the screws in a safe place and separate them to avoid confusion when reassembling.

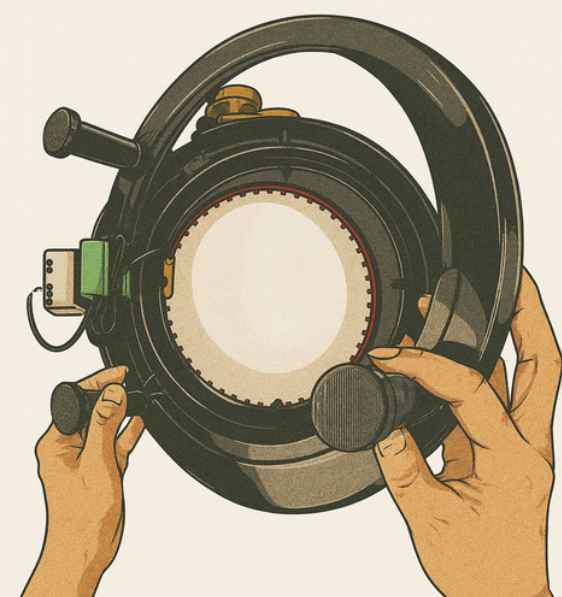

Remove the base of the machine.

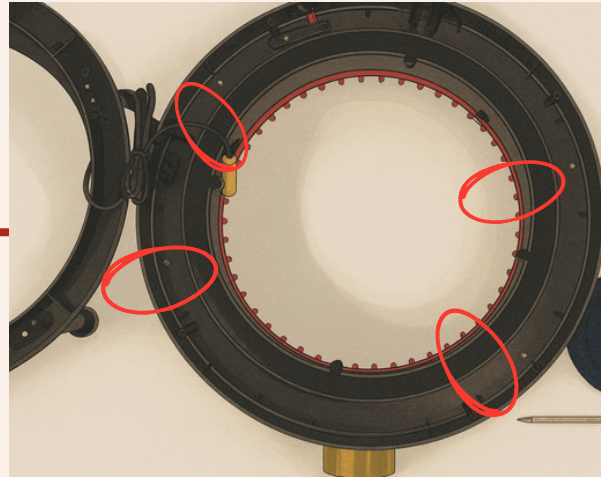


Unscrew the four screws securing the main body.

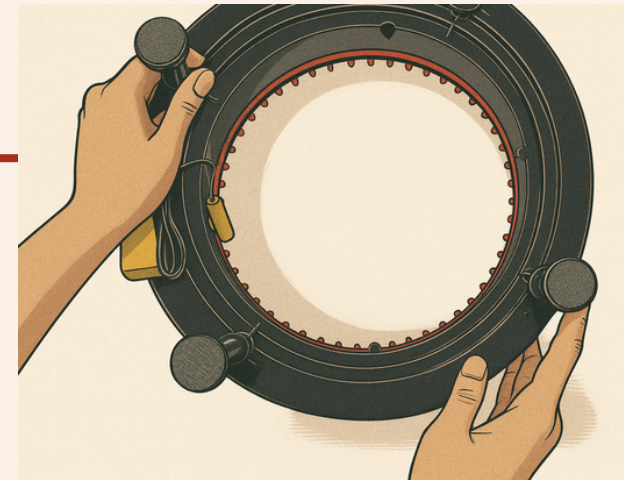


Place the base back onto the machine.

Flip the machine upright again.


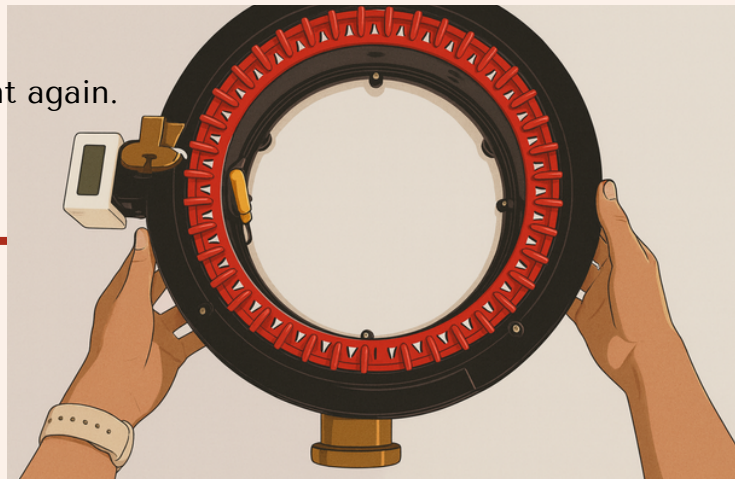


Step 2: Remove the Handle

Take off the main case of the machine.

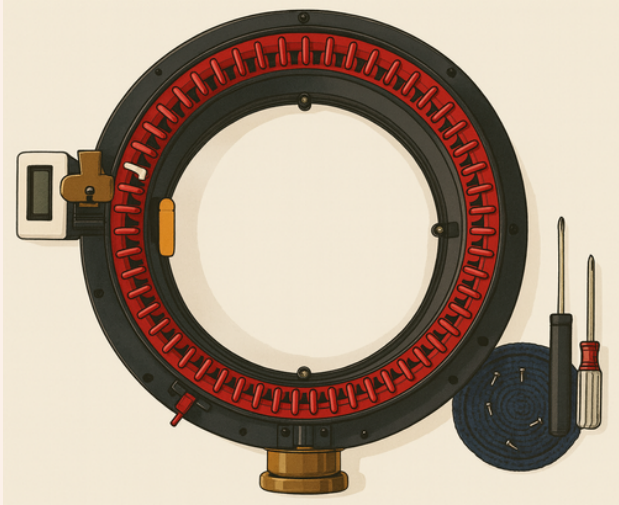


Using the small flat-head screwdriver, remove the two screws securing the handle.

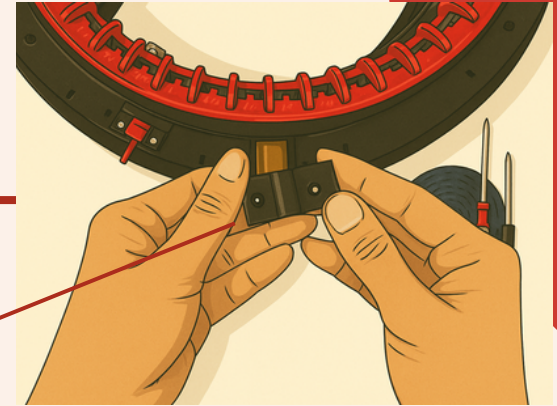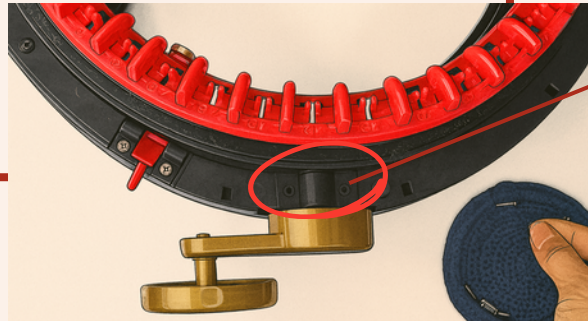


Detach the black attachment connected to the handle.

Remove the handle completely.

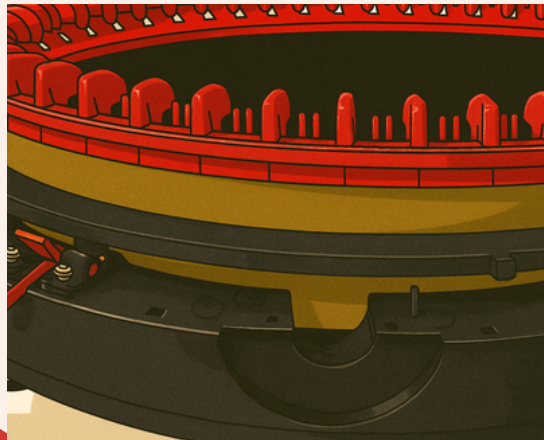


Carefully lift the two internal rings (black and gold).

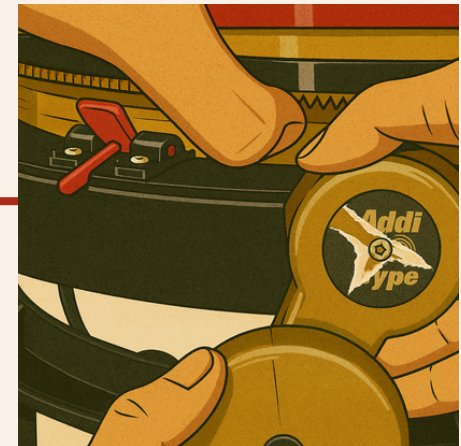

Step 3: Install the Ultimate Adapter


Take your Ultimate Adapter (if it's for an Addi machine, ensure the provided ring is attached).

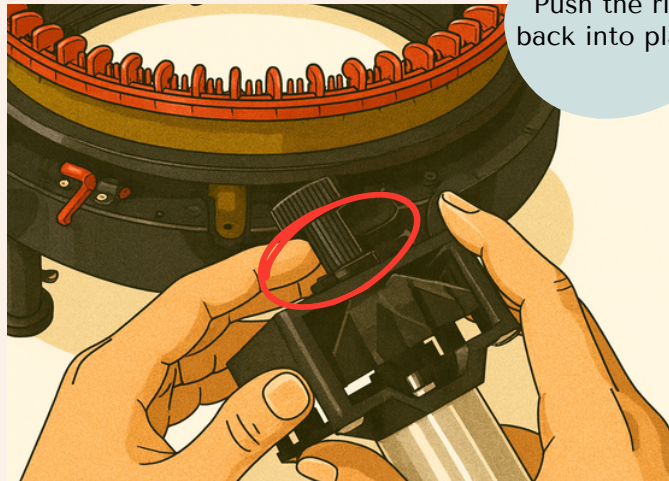

Push the ring back into place.

Lift the two internal rings (black and gold) slightly and position the Ultimate Adapter.

Rotate the manual handle of the adapter to ensure proper alignment with the needles.

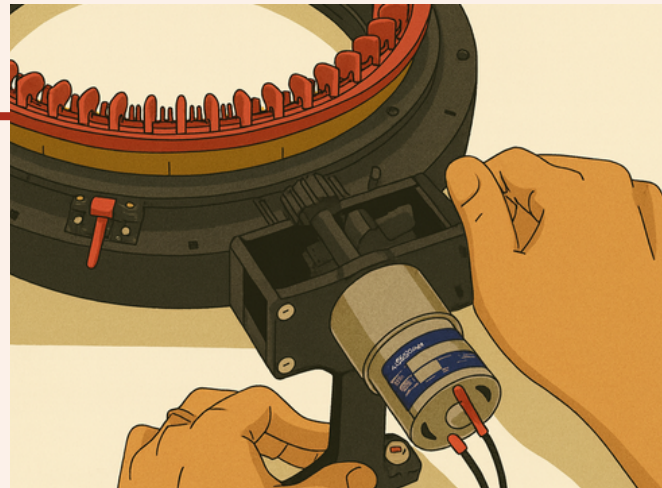


Double-check the spindle mechanism to ensure all components are securely in place

If the needles lift out of place, manually adjust them using the red ring until they fit perfectly again.


Step 4: Reassemble the Machine

Reattach the black handle attachment, ensuring the bump aligns with the hole in the machine.

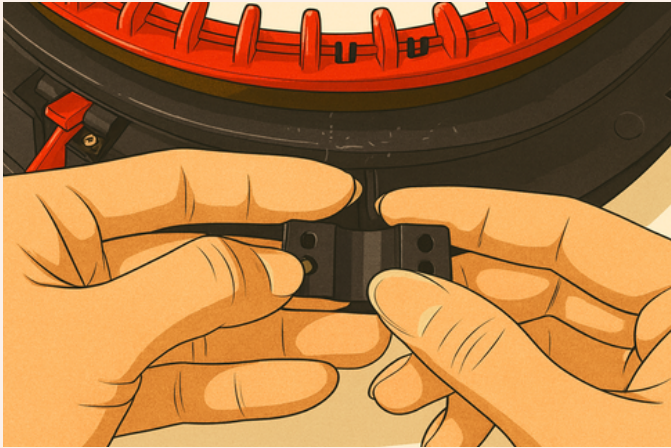


Press it firmly into place to secure it.

Screw the two screws back into the attachment.

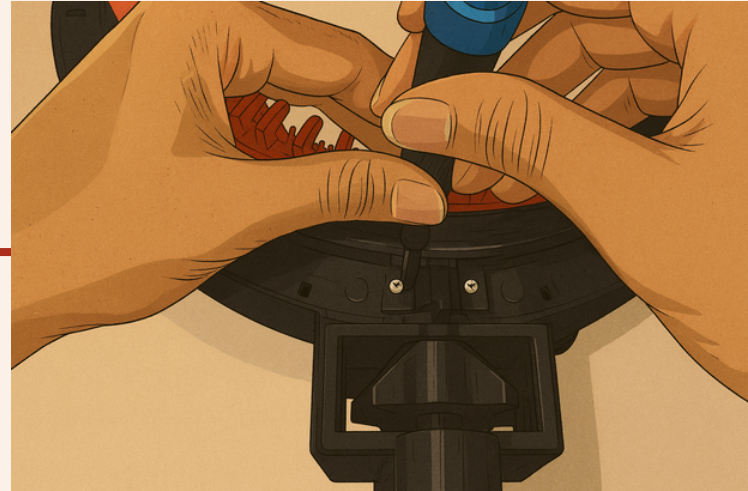

Double-check the spindle mechanism to ensure all components are securely in place.

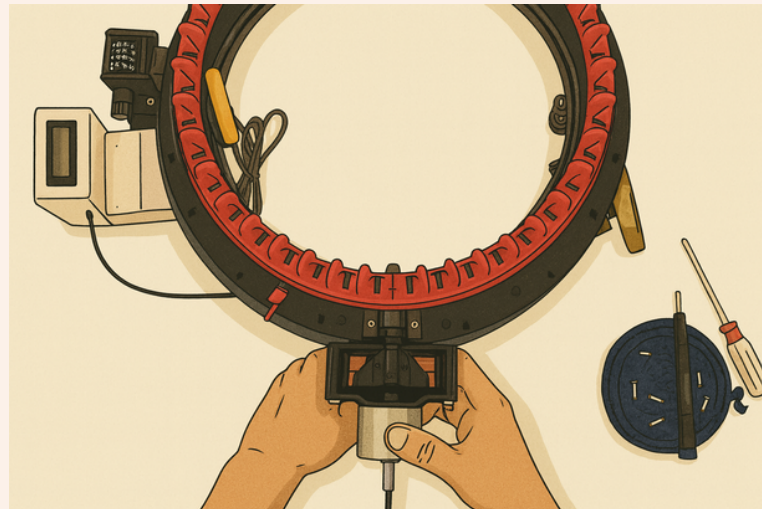


Lift the suction cups of the ultimate adapter




Reinstall the main case, ensuring it fits evenly with the base.

Reattach the cover legs, aligning them with the screw holes.

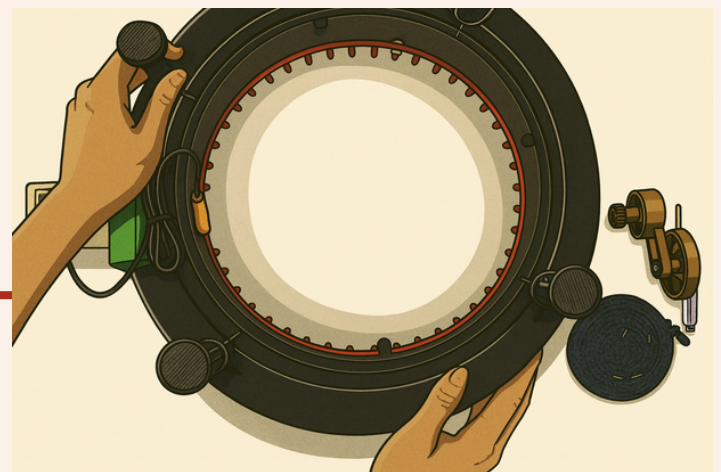


Secure the four screws for the cover legs

Flip the machine upside down again.

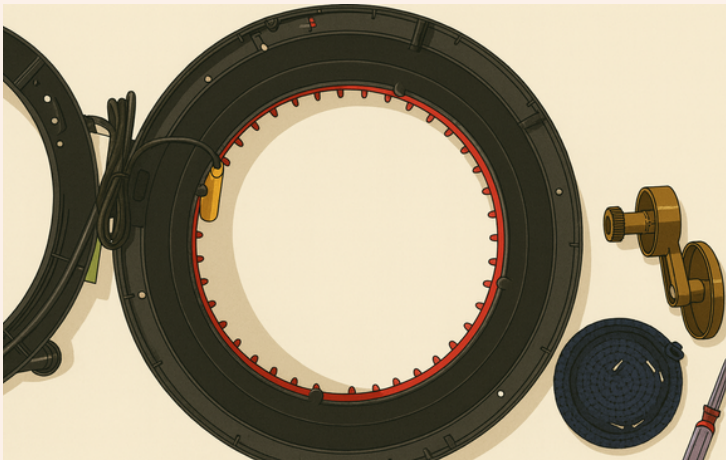


Remove the base and reinsert the four screws into the machine body.

Secure the two screws for the counter.

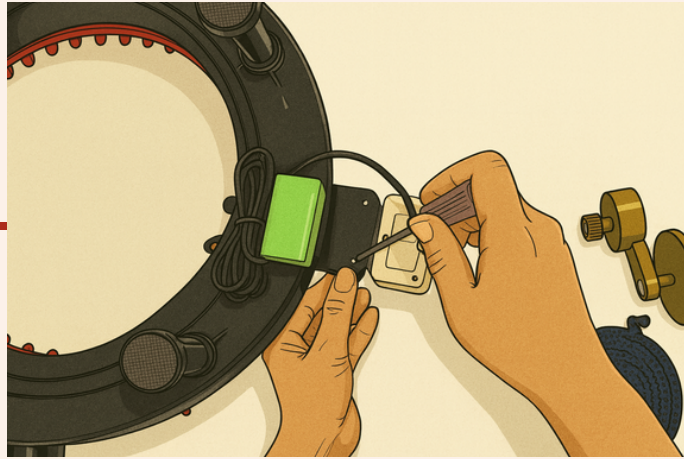


Step 5: Test the Installation

Flip the machine upright and secure the suction cups on a solid surface and test it manually by rotating the handle.

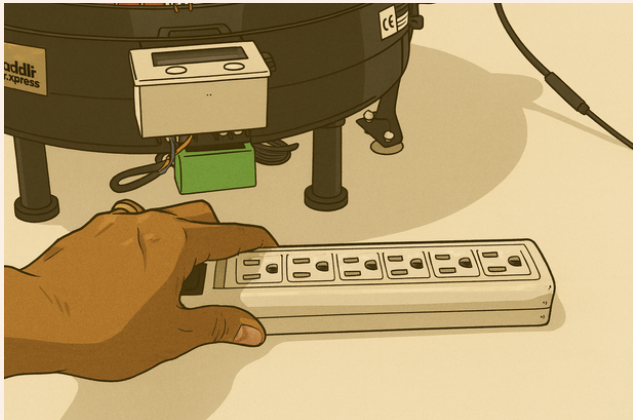

Once confirmed that it operates smoothly, connect the power adapter.

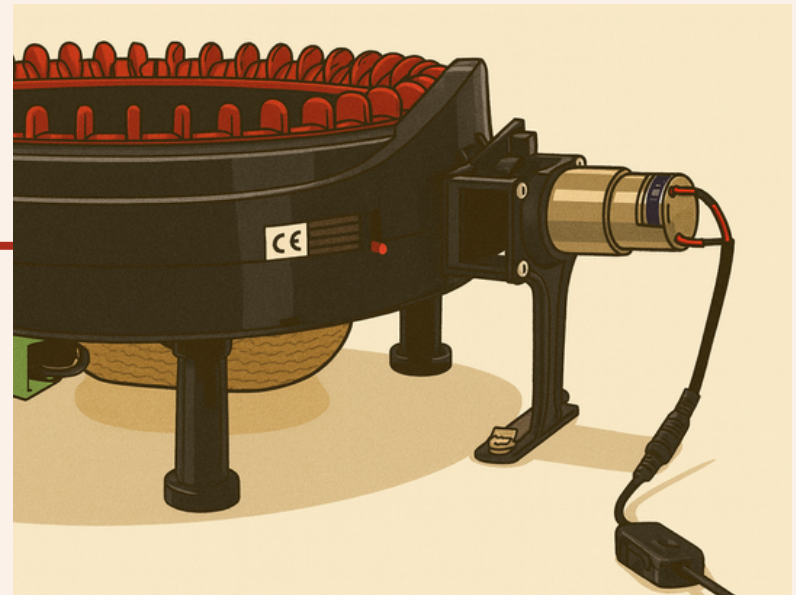

Your machine is now ready to use!

Ultimate Adapter Installation Guide for Addi Circular Knitting Machine

Tools Needed:


- Small Phillips head screwdriver

Step 1: Disassemble the Machine


Flip the knitting machine upside down.




Using the small Phillips head screwdriver

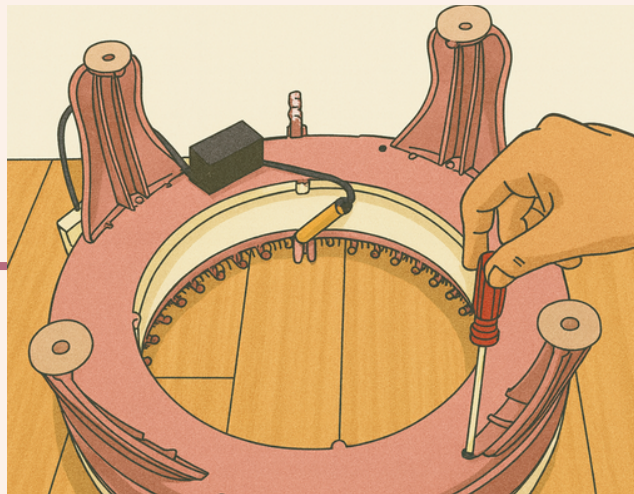

Remove the **seven screws** from the cover legs.

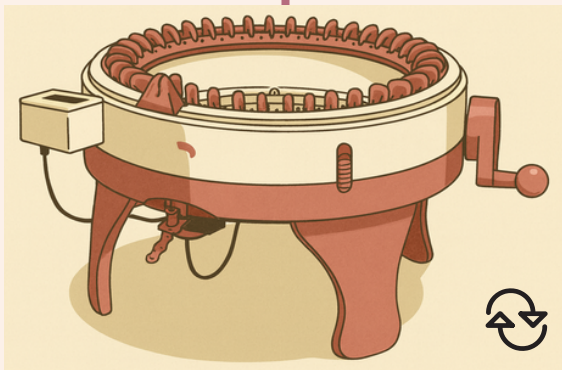


Flip the machine upright again.

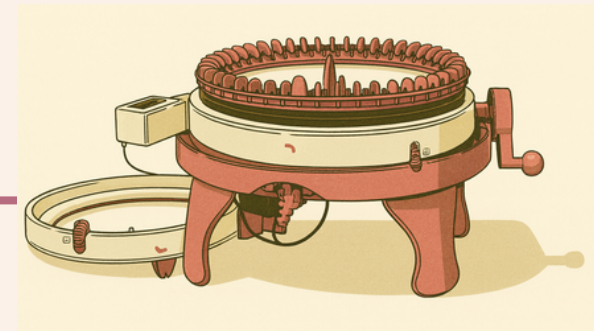


Take off the main case of the machine.


Step 2: Remove the Handle

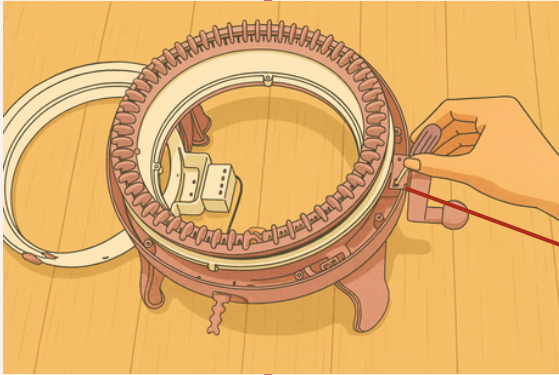

Using the Small Phillips head screwdriver, remove the two screws securing the handle.


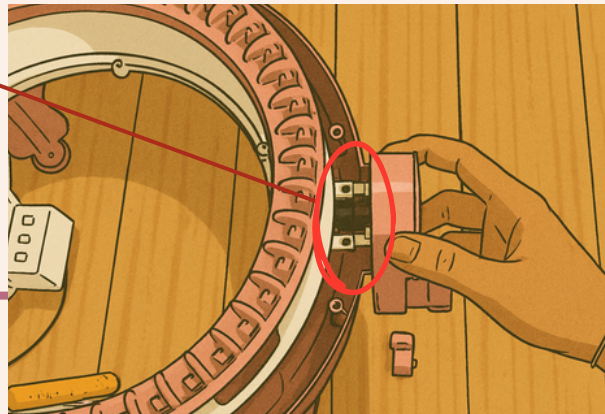


Carefully lift the internal rings (black) and remove the handle.

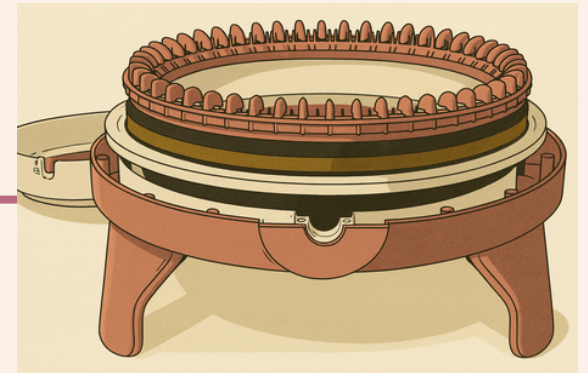


Step 3: Install the Ultimate Adapter

Screw the pink piece back again, to secure the adapter

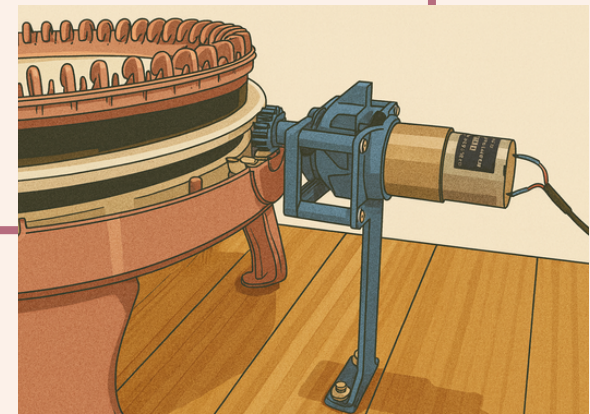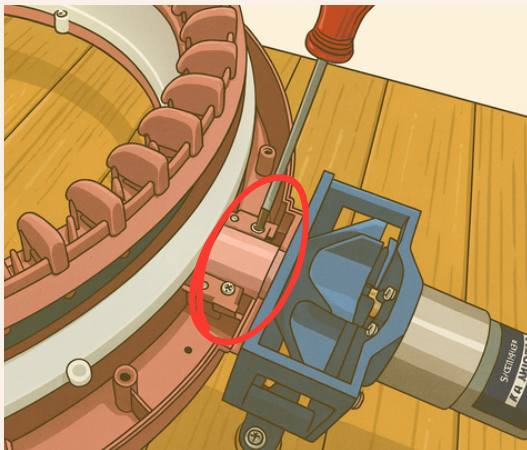


Take your Ultimate Adapter, Lift the black internal ring slightly and position the Ultimate Adapter.

Step 4: Reassemble the Machine

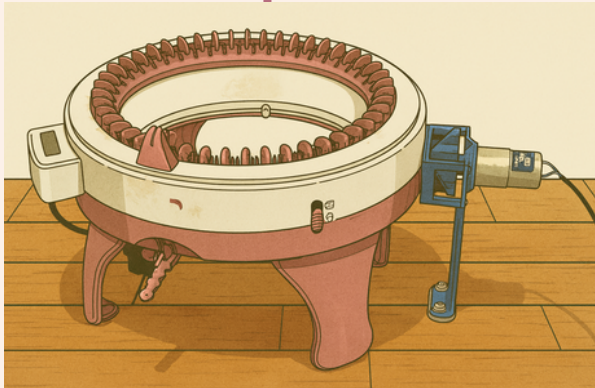

Reinstall the main case, ensuring it fits evenly with the base.


Flip the machine upside down again.

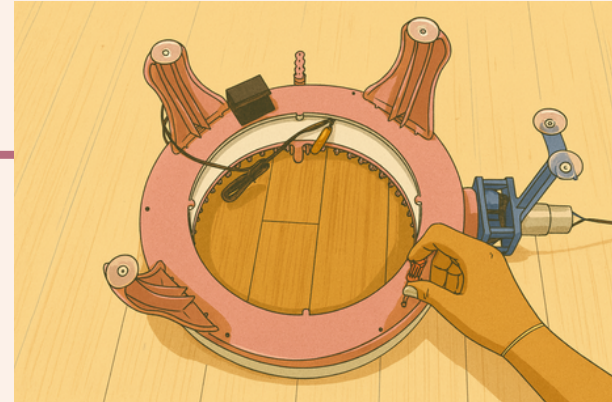

Secure the seven screws for the cover legs

Step 5: Test the Installation

Flip the machine upright and secure the suction cups on a solid surface and test it manually by rotating the handle. Once confirmed that it operates smoothly, connect the power adapter.

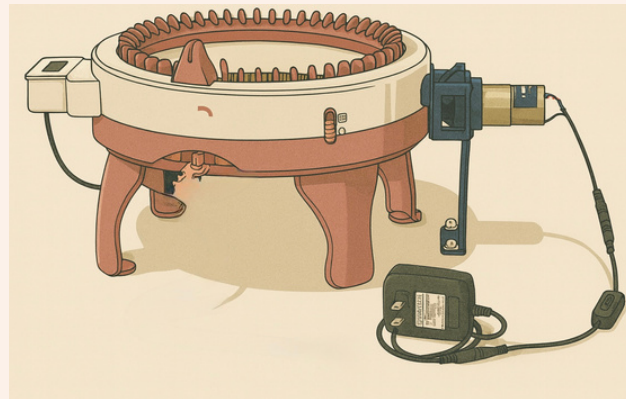

Your machine is now ready to use!